



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## **Bengalla Mine**

# **State Significant Development 5170 Monthly Monitoring Data Summary**

## **February 2020**



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500  
F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## CONTENTS

1. INTRODUCTION .....	3
2. AIR QUALITY .....	4
3. NOISE .....	8
4. BLASTING .....	9

## TABLES

Table 1. PM <sub>10</sub> Monitoring Summary .....	4
Table 2. TSP Monitoring Summary .....	5
Table 3. Depositional Dust Monitoring Summary .....	7
Table 4. Noise – Bengalla Only <sup>1</sup> LAeq (15 minute) Monitoring Summary .....	8
Table 5. Blast Overpressure Monitoring Summary .....	10



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## 1. INTRODUCTION

State Significant Development (SSD) 5170 (as modified) requires the Bengalla Mining Company Pty Ltd (BMC) to make a comprehensive summary of the Bengalla Mine (Bengalla) monitoring results, reported in accordance with the specifications in any conditions of SSD-5170 (as modified), or any approved plans and programs, publicly available on its website. This document has been prepared in accordance with the Department of Planning and Environment (DPE) *Web-Based Reporting Guideline* (October 2015) to satisfy the above requirement.

This document provides a summary of environmental monitoring data sampled as prescribed by SSD-5170 (as modified) for February 2020 (Reporting Period). Monitoring data provided is as follows:

- Air quality, particulate matter less than 10 microns (PM<sub>10</sub>), total suspended particulate (TSP) matter and depositional dust;
- Noise; and
- Blast overpressure and ground vibration.

## 2. AIR QUALITY

The air quality monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Air Quality Management Plan (AQMP). Air quality monitoring results relevant to SSD-5170 are summarised in the following sections.

### 2.1 Particulate Matter less than 10 Microns

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains four High Volume Air Samplers (HVAS) measuring PM<sub>10</sub>. The HVAS are run for 24 hours every six days.

PM<sub>10</sub> data for the Reporting Period is provided in **Table 1**.

<b>Pollutant:</b>	PM <sub>10</sub>
<b>Unit of measure:</b>	Micrograms per cubic metre (µg/m <sup>3</sup> )
<b>Monitoring location:</b>	See <b>Table 1</b> and <b>Appendix A</b> .
<b>Monitoring frequency:</b>	24 hours every 6 days
<b>24 Hour Average Criteria:</b>	50 µg/m <sup>3</sup>
<b>Annual Average Criteria:</b>	25 µg/m <sup>3</sup>
<b>Sampled:</b>	01/02/2020 – 29/02/2020

**Table 1. PM<sub>10</sub> Monitoring Summary**

Run Date	Run Date Reading (µg/m <sup>3</sup> )			
	PM10-1 Racecourse Road	PM10-2 St James School	PM10-3 Roxburgh Road	PM10-4 Wybong Road
02/02/2020	69	42	57	54
08/02/2020	14	12	25	22
14/02/2020	25	29	33	41
20/02/2020	30	27	30	33
26/02/2020	16	10	10	11

(Table 1 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))

## 2.2 Total Suspended Particle Matter

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains five HVAS measuring TSP. The HVAS are run for 24 hours every six days.

TSP data for the Reporting Period is provided in **Table 2**.

<b>Pollutant:</b>	TSP
<b>Unit of measure:</b>	µg/m <sup>3</sup>
<b>Monitoring location:</b>	See <b>Table 2</b> and <b>Appendix B</b> .
<b>Monitoring frequency:</b>	24 hours every 6 days
<b>Annual Average Criteria:</b>	90 µg/m <sup>3</sup>
<b>Sampled:</b>	28/01/2020 – 29/02/2020

**Table 2. TSP Monitoring Summary**

Run Date	Run Date Reading (µg/m <sup>3</sup> )				
	HV01 Wybong Road (East)	HV02 Racecourse Road	HV03 Logues Lane	HV04 St James School	HV06 Wybong Road (West)
02/02/2020	148	124	86	114	115
08/02/2020	36	47	24	31	82
14/02/2020	59	61	53	56	138
20/02/2020	69	81	62	79	109
26/02/2020	34	86	17	25	20

(Table 2 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## 2.3 Depositional Dust

To evaluate the performance of Bengalla against the SSD-5170 criterion for depositional dust, BMC operates and maintains 14 depositional dust gauges surrounding the Bengalla operations.

Depositional dust data for the Reporting Period is provided in **Table 3**.

<b>Pollutant:</b>	Depositional Dust
<b>Unit of measure:</b>	Grams per metre squared per month (g/m <sup>2</sup> /month)
<b>Monitoring location:</b>	See <b>Table 3</b> and <b>Appendix C</b> .
<b>Monitoring frequency:</b>	Monthly
<b>Maximum depositional dust increase criteria:</b>	2 g/m <sup>2</sup> /month <sup>(b)</sup>
<b>Maximum total depositional dust criteria:</b>	4 g/m <sup>2</sup> /month <sup>(a)</sup>
<b>Sampled:</b>	16/01/2019 – 18/02/2020

(a) Total impact (ie incremental increase in concentrations due to the development plus background concentrations due to other sources);

(b) Incremental impact (ie incremental increase in concentration due to the development on its own)



Bengalla Mining Company Pty Limited

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500  
F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

**Table 3. Depositional Dust Monitoring Summary**

Sampling point		Measured Value (February 2020) g/m <sup>2</sup> /month	Sampling Comments
D01	Queen Street, Muswellbrook	3.5	Insects
D02	King Street, Muswellbrook	6.1	Insects
D04A	Industrial Estate, Muswellbrook	5.0	Insects
D05	Intersection Kayuga and Wybong Road, Muswellbrook	6.3	Insects, vegetation
D06	Logues Lane, Muswellbrook	4.5	Insects
D07A	St James School, Muswellbrook	5.9	Insects
D08	Denman Road, Muswellbrook	3.4	Insects
D09	Wybong Road, Muswellbrook	5.5	Insects
D10	Racecourse Road, Muswellbrook	6.3	Insects
D20	Wyndam Arms R.O.W., Muswellbrook	7.3	Insects
D23B	Logues Lane, Muswellbrook	3.9	Insects, spider
D25	Roxburgh Road, Muswellbrook	5.2	Insects
D26	Wybong Road, Muswellbrook	6.5	Insects
DA	Roxburgh Road, Muswellbrook	5.7	Insects

(Table 3 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))

Operator, for and on behalf of Bengalla Joint Venture, an unincorporated joint venture between:  
New Hope Bengalla Pty Ltd, Taipower Bengalla Pty Limited.

### 3. NOISE

The noise monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Noise Management Plan (NMP).

Compliance attended noise monitoring is undertaken for 15 minutes once per calendar month during the night period (10 pm to 7 am) at three locations representative of the nearest private receivers.

Noise monitoring data for the Reporting Period is provided in **Table 4**.

<b>Pollutant:</b>	Noise – Bengalla Only
<b>Unit of measure:</b>	L <sub>Aeq</sub> (15 minute)
<b>Monitoring location:</b>	See <b>Table 4</b> and <b>Appendix D</b> .
<b>Monitoring frequency:</b>	Monthly
<b>AN01 criteria:</b>	35 dB(A)
<b>AN04 criteria:</b>	35 dB(A)
<b>AN03 criteria:</b>	40 dB(A)
<b>Sampled:</b>	25 February 2020

**Table 4. Noise – Bengalla Only<sup>1</sup> LAeq (15 minute) Monitoring Summary**

Sampling point		Sample Date	Sample Time	Measured value
AN01	1431 Wybong Road	25/02/2020	00:03 – 00:18	27
AN03	1312 Denman Road	25/02/2020	00:41 – 00:56	29
AN04	Opposite 9 Racecourse Road	25/02/2020	01:16 – 01:31	IA

1. LAeq, 15minute operational noise levels for Bengalla in the absence of all other noise sources.

IA - Inaudible. When there was no noise from the source of interest (Bengalla Mine) audible at the monitoring location.





**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## 4. BLASTING

BMC maintains three blast monitors to measure blast overpressure and ground vibration against the SSD-5170 criteria.

The blast overpressure and ground vibration data for the Reporting Period is provided in **Table 5**.

<b>Pollutant:</b>	Air blast overpressure & ground vibration peak particle velocity
<b>Unit of measure:</b>	dB (Lin Peak) and millimetres per second ( <b>mm/s</b> )
<b>Monitoring locations:</b>	See <b>Tables 5</b> and <b>Appendix D</b> .
<b>Monitoring frequency:</b>	All blasts
<b>Overpressure criteria:</b>	a) 115 linear decibels ( <b>dB(L)</b> ) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 120 dB(L) at any time.
<b>Ground vibration criteria:</b>	a) exceed 5 millimetres/second ( <b>mm/s</b> ) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 10mm/s at any time.
<b>Sampled:</b>	01/02/2020 – 2/02/2020

**Table 5. Blast Overpressure Monitoring Summary**

Date	Time	Ground Vibration (mm/s)			Overpressure (dBL)		
		BLK	MRE	SCH	BLK	MRE	SCH
01/02/20	3:53:08PM	0.24	2.04	0.07	101.1	100.9	89.4
05/02/20	11:22:45 AM	0.22	0.84	0.14	89.5	98.7	85.0
05/02/20	11:23:45 AM	0.17	0.92	0.15	94.9	93.9	82.5
07/02/20	3:28:12 PM	0.26	1.21	0.14	100.0	102.0	92.5
10/02/20	1:55:15 PM	0.06	0.40	0.04	89.0	85.9	84.2
10/02/20	1:56:53 PM	0.07	0.74	0.03	88.0	104.3	91.2
11/02/20	4:36:11 PM	0.13	0.80	0.09	84.3	101.5	88.1
13/02/20	10:54:50AM	0.03	0.27	0.01	97.4	104.6	89.3
18/02/20	11:38:34 AM	0.22	1.48	0.18	90.8	105.8	100.2
20/02/20	3:02:23 PM	0.24	1.40	0.17	88.2	98.1	93.4
20/02/20	3:14:09 PM	0.31	2.25	0.07	92.8	103.6	96.4
24/02/20	11:27:36 AM	0.11	0.87	0.05	93.8	101.1	94.2
26/02/20	12:02:18 PM	0.13	0.69	0.07	95.3	94.1	94.2
28/02/20	4:34:58 PM	0.09	0.27	0.04	98.4	94.9	84.8
28/02/20	4:33:56 PM	0.09	0.79	0.09	91.2	99.7	86.2
28/02/20	4:32:39 PM	0.15	1.09	0.08	93.6	105.6	90.1

# **Appendix A**

## **PM10 Monitoring Locations**



MUSWELLBROOK

PM4

Wybong Road

PM1

PM2

Bengalla Link Road

PM3




BENGALLA MINE

PM10 Monitoring Locations

PRJ31060\_BengallaMineNSW\_50cm\_19102017\_gda94mga56\_ortho\_full-area

# **Appendix B**

## **TSP Monitoring Locations**

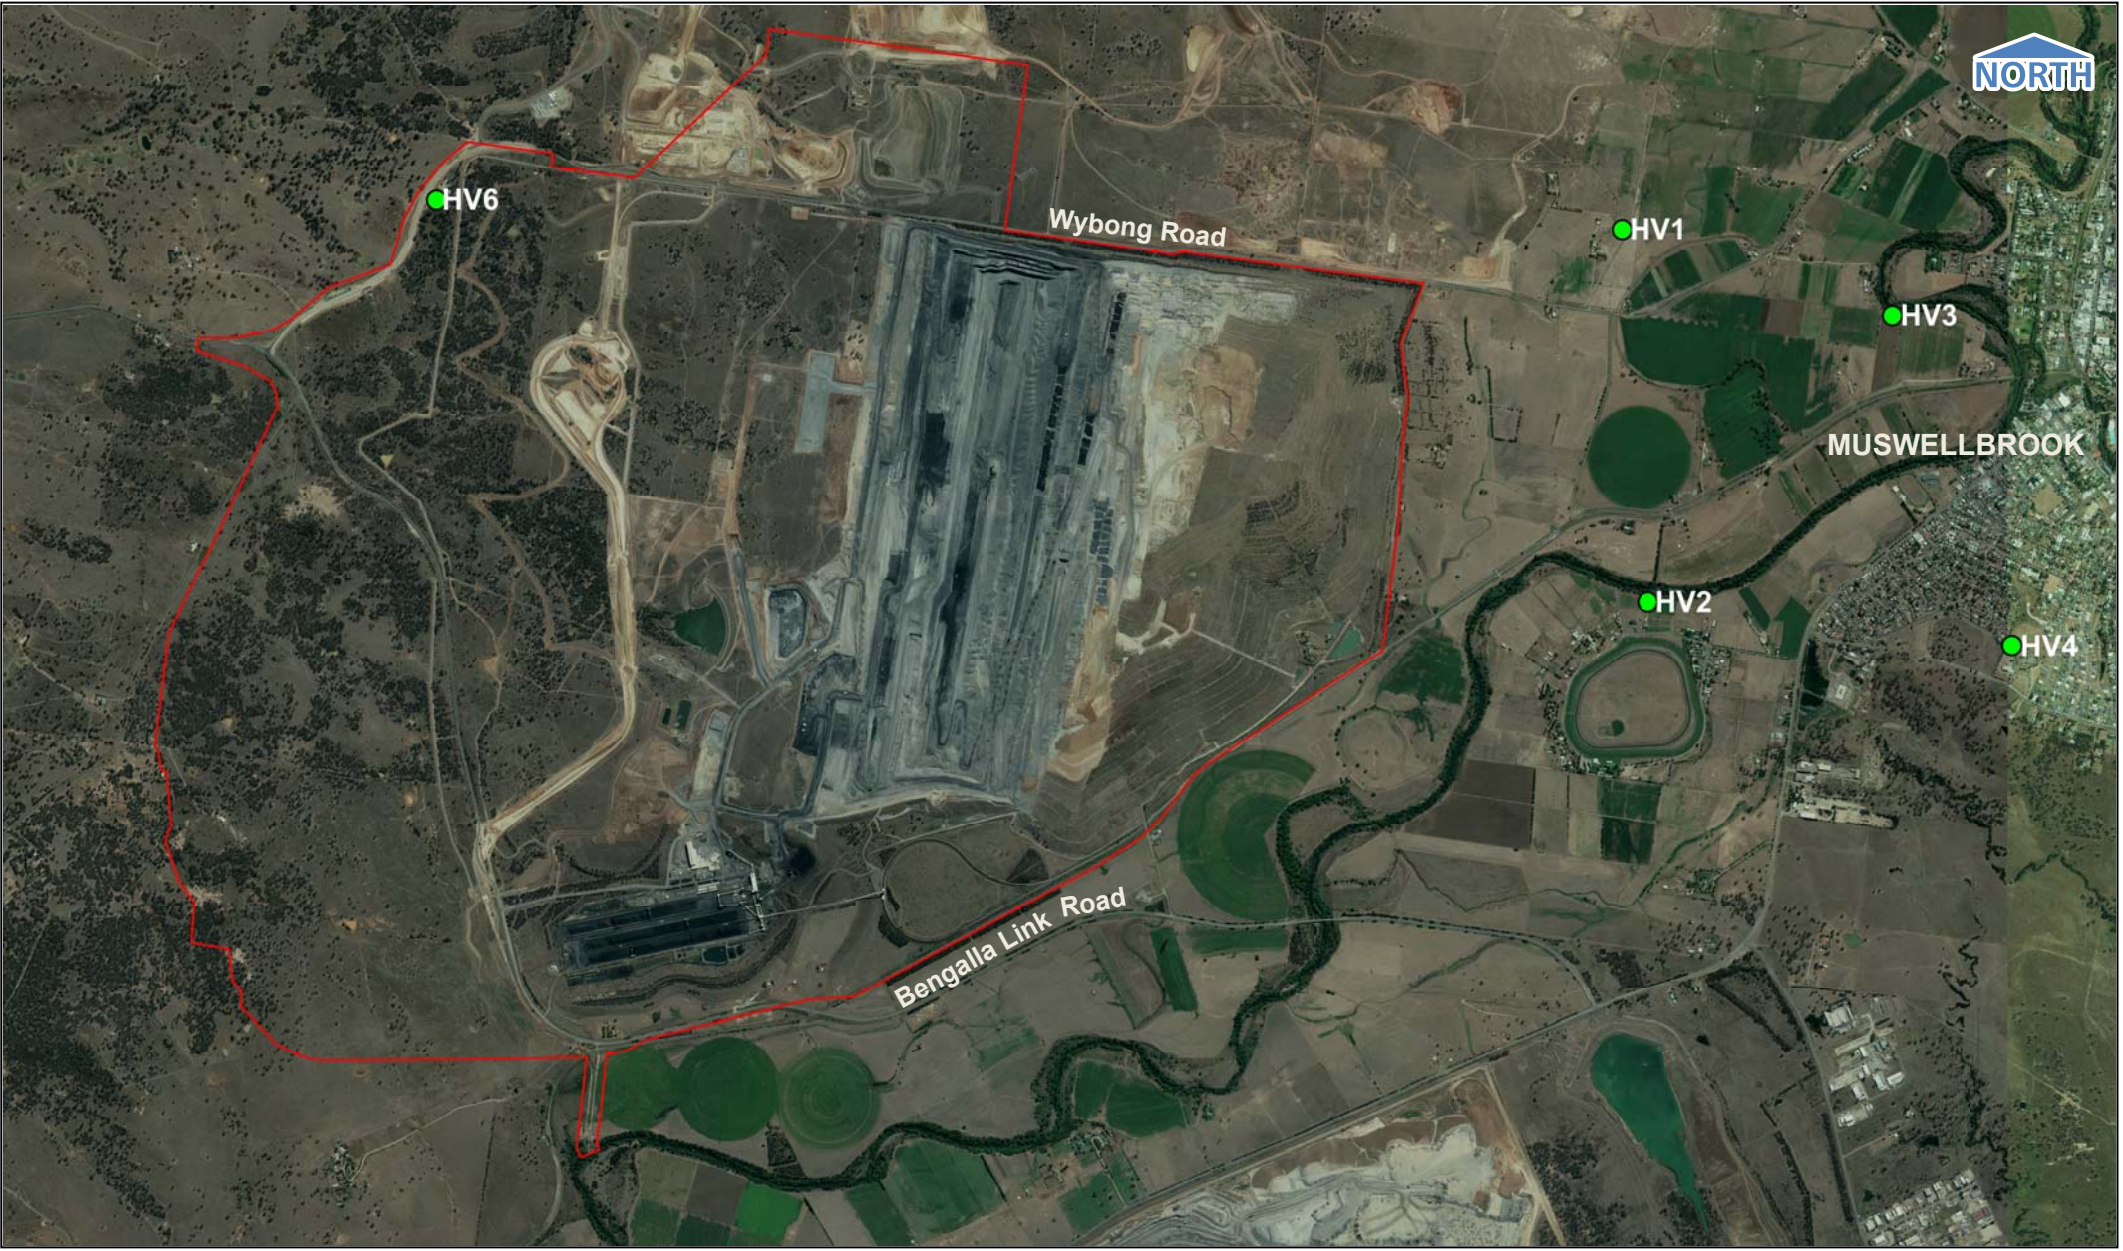

PRJ31060\_BengallaMineNSW\_50cm\_19102017\_gda94mga56\_ortho\_full-area



BENGALLA MINE  
TSP Monitoring Locations

# **Appendix C**

## **Depositional Dust Monitoring Locations**

PRJ31060\_BengallaMineNSW\_50cm\_19102017\_gda94mga56\_ortho\_full-area



BENGALLA MINE  
Depositional Dust Monitoring Locations




## **Appendix D**

### **Noise and Blast Monitoring Locations**

Location	Easting	Northing
BLK (EPA20)	300098	6429731
MRE (EPA12)	292469	6428948
SCH (EPA19)	300730	6426731
AN01 (EPA07)	289836	6428049
AN03 (EPA08)	290861	6421509
AN04 (EPA09)	298808	6426782

HB BENGALLA EPL 1428 F1 Bengalla Compliance Acoustic Monitoring Network - Aerial Version 09 09 2016

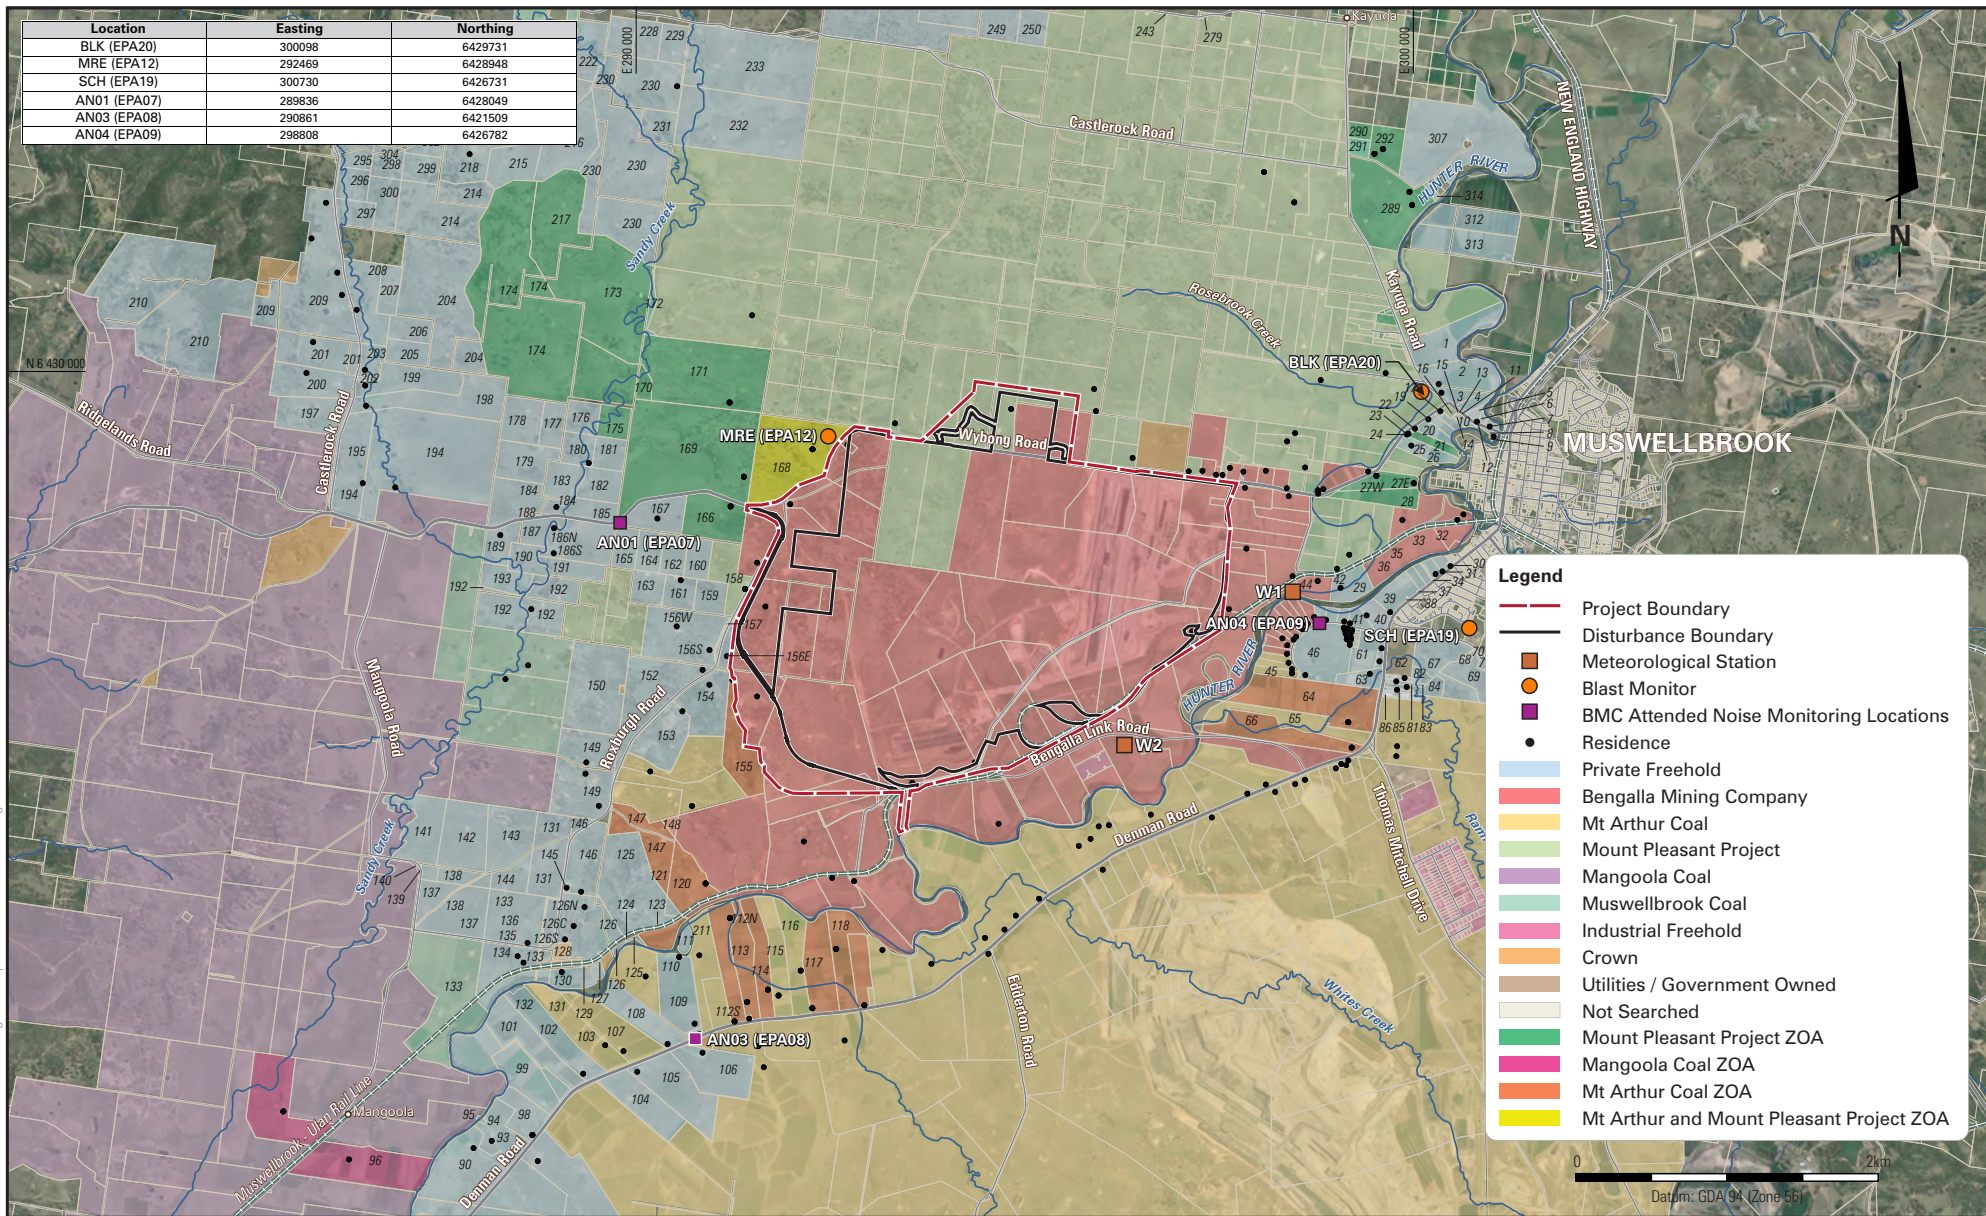

BENGALLA MINE

Bengalla Compliance Acoustic Monitoring Network

**FIGURE 1**

