



Bengalla Mining Company Pty. Limited

Bengalla Road, (Locked Mailbag 5)

Muswellbrook NSW 2333 Australia

A.B.N. 32 053 909 470

Bengalla Mine

State Significant Development 5170 Monthly Monitoring Data Summary

January 2018



Bengalla Mining Company Pty. Limited

Bengalla Road, (Locked Mailbag 5)

Muswellbrook NSW 2333 Australia

A.B.N. 32 053 909 470

CONTENTS

1. INTRODUCTION	1
2. AIR QUALITY	2
3. NOISE	6
4. BLASTING	7

TABLES

Table 1. PM ₁₀ Monitoring Summary	2
Table 2. TSP Monitoring Summary	3
Table 3. Depositional Dust Monitoring Summary	5
Table 4. Noise – Bengalla Only ¹ LAeq (15 minute) Monitoring Summary	6
Table 5. Blast Overpressure Monitoring Summary	8



1. INTRODUCTION

State Significant Development (SSD) 5170 requires the Bengalla Mining Company Pty Ltd (BMC) to make a comprehensive summary of the Bengalla Mine (Bengalla) monitoring results, reported in accordance with the specifications in any conditions of SSD-5170, or any approved plans and programs, publicly available on its website. This document has been prepared in accordance with the Department of Planning and Environment (DPE) *Web-Based Reporting Guideline* (October 2015) to satisfy the above requirement.

This document provides a summary of environmental monitoring data sampled as prescribed by SSD-5170 for January 2018 (Reporting Period). Monitoring data provided is as follows:

- Air quality, particulate matter less than 10 microns (PM₁₀), total suspended particulate (TSP) matter and depositional dust;
- Noise; and
- Blast overpressure and ground vibration.

Monitoring Data Obtained: 12 February 2018

Monitoring Data Published: 26 February 2018



2. AIR QUALITY

The air quality monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Air Quality Management Plan (AQMP). Air quality monitoring results relevant to SSD-5170 are summarised in the following sections.

2.1 Particulate Matter less than 10 Microns

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains a network of three High Volume Air Samplers (HVAS) measuring PM₁₀. Additional, PM₁₀ data is sourced from Mt Arthur Coal through an information sharing agreement. The HVAS are run for 24 hours every six days.

PM₁₀ data for the Reporting Period is provided in **Table 1**.

Pollutant:	PM ₁₀
Unit of measure:	Micrograms per cubic metre (µg/m ³)
Monitoring location:	See Table 1 and Appendix A .
Monitoring frequency:	24 hours every 6 days
24 Hour Average Criteria:	50 µg/m ³
Annual Average Criteria:	90 µg/m ³
Sampled:	01/01/2018 – 31/01/2018

Table 1. PM₁₀ Monitoring Summary

Run Date	Run Date Reading (µg/m ³)			
	PM10-1 Racecourse Road	PM10-2 St James School	PM10-3* Roxburgh Road	PM10-4 Wybong Road
01/01/2018	40	31	63	58
07/01/2018	40	45	25	16
13/01/2018	73	45	42	26
19/01/2018	52	38	91	120
25/01/2018	54	42	46	76
31/01/2018	44	32	19	68

* Data sourced from Mt Arthur Coal

For the Reporting Period, no elevated 24-hour average PM¹⁰ readings were recorded at PM10-2.

Elevated 24-hour average PM¹⁰ readings were recorded at PM10-1 on 13, 19 and 25 January 2018.

Elevated 24-hour average PM¹⁰ readings were recorded at PM10-3 on 1 and 19 January 2018.

Elevated 24-hour average PM¹⁰ readings were recorded at PM10-4 on 1, 19, 25 and 31 January 2018.



2.2 Total Suspended Particle Matter

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains a network of five HVAS measuring TSP. The HVAS are run for 24 hours every six days.

TSP data for the Reporting Period is provided in **Table 2**.

Pollutant:	TSP
Unit of measure:	µg/m ³
Monitoring location:	See Table 2 and Appendix B .
Monitoring frequency:	24 hours every 6 days
Annual Average Criteria:	90 µg/m ³
Sampled:	01/01/2018 – 31/01/2018

Table 2. TSP Monitoring Summary

Run Date	Run Date Reading (µg/m ³)				
	HV01 Wybong Road (East)	HV02 Racecourse Road	HV03 Logues Lane	HV04 St James School	HV06 Wybong Road (West)
01/01/2018	78	105	71	69	155
07/01/2018	56	109	60	52	73
13/01/2018	221	173	146	117	77
19/01/2018	141	140	106	97	401
25/01/2018	136	156	122	116	286
31/01/2018	92	130	113	96	210



2.3 Depositional Dust

To evaluate the performance of Bengalla against the SSD-5170 criterion for depositional dust, BMC operates and maintains a network of 14 depositional dust gauges surrounding the Bengalla operations.

Depositional dust data for the Reporting Period is provided in **Table 3**.

Pollutant:	Depositional Dust
Unit of measure:	Grams per metre squared per month (g/m ² /month)
Monitoring location:	See Table 3 and Appendix C .
Monitoring frequency:	Monthly
Maximum depositional dust increase criteria:	2 g/m ² /month
Maximum total depositional dust criteria:	4 g/m ² /month
Sampled:	01/01/2018 – 31/01/2018



Bengalla Mining Company Pty. Limited

Bengalla Road, (Locked Mailbag 5)

Muswellbrook NSW 2333 Australia

A.B.N. 32 053 909 470

Table 3. Depositional Dust Monitoring Summary

Sampling point		Measured Value	Sampling Comments
D01	Queen Street, Muswellbrook	1.2	Insects
D02	King Street, Muswellbrook	1.6	Insects
D04A	Industrial Estate, Muswellbrook	2.6	Insects
D05	Intersection Kayuga and Wybong Road, Muswellbrook	1.7	Insects
D06	Logues Lane, Muswellbrook	0.1 *	Insects (funnel broken, low water level, invalid result)
D07A	St James School, Muswellbrook	2.0	Insects
D08	Denman Road, Muswellbrook	1.9	Insects
D09	Wybong Road, Muswellbrook	2.3	Insects
D10	Racecourse Road, Muswellbrook	7.0 **	Insects, contaminated by irrigation
D20	Wyndams Arms R.O.W., Muswellbrook	6.4	Insects
D23B	Logues Lane, Muswellbrook	2.7	Insects
D25	Roxburgh Road, Muswellbrook	6.8	Insects
D26	Wybong Road, Muswellbrook	3.3	Insects
DA	Roxburgh Road, Muswellbrook	2.4	Insects



3. NOISE

The noise monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Noise Management Plan (NMP).

BMC undertakes compliance attended noise monitoring for 15 minutes once per calendar month during the night period (10 pm to 7 am) at three locations representative of the nearest private receivers.

Noise monitoring data for the Reporting Period is provided in **Table 4**.

Pollutant:	Noise – Bengalla Only
Unit of measure:	L _{Aeq} (15 minute)
Monitoring location:	See Table 4 and Appendix D .
Monitoring frequency:	Monthly
AN01 criteria:	35 dB(A)
AN04 criteria:	35 dB(A)
AN03 criteria:	40 dB(A)
Sampled:	24 January 2018

Table 4. Noise – Bengalla Only¹ LAeq (15 minute) Monitoring Summary

Sampling point		Sample Date	Sample Time	Measured value
AN01	1431 Wybong Road	24/01/18	22:37	23
AN03	1312 Denman Road	24/01/18	23:12	<30
AN04	Opposite 9 Racecourse Road	24/01/18	23:40	<25

1.LAeq,15minute operational noise levels for Bengalla in the absence of all other noise sources.

For the Reporting Period noise data were below the SSD-5170 criteria.



4. BLASTING

BMC maintains three blast monitors to measure blast overpressure and ground vibration against the SSD-5170 criteria.

The blast overpressure and ground vibration data for the Reporting Period is provided in **Table 5**.

Pollutant:	Air blast overpressure & ground vibration peak particle velocity
Unit of measure:	dB (Lin Peak) and millimetres per second (mm/s)
Monitoring locations:	See Tables 5 and 6 and Appendix D .
Monitoring frequency:	All blasts
Overpressure criteria:	a) 115 linear decibels (dB(L)) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 120 dB(L) at any time.
Ground vibration criteria:	a) exceed 5 millimetres/second (mm/s) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 10mm/s at any time.
Sampled:	01/01/2018 – 31/01/2018



Table 5. Blast Overpressure Monitoring Summary

Date	Time of Blast	Ground Vibration (mm/s)			Overpressure (dBL)		
		BLK	MRE	SCH	BLK	MRE	SCH
02/01/18	12:05:25 PM	0.19	0.81	0.07	104.10	105.80	85.80
03/01/18	10:59:40 AM	0.21	1.83	0.07	110.80	108.20	94.10
04/01/18	3:34:31 PM	0.53	2.18	0.14	89.50	100.50	95.30
06/01/18	10:50:36 AM	0.09	0.64	0.04	89.90	92.30	90.90
09/01/18	3:20:35 PM	0.17	0.63	0.20	84.80	96.80	88.00
09/01/18	3:21:37 PM	0.24	2.31	0.24	87.50	96.50	86.90
10/01/18	3:31:32 PM	0.05	0.18	0.02	111.10	107.80	100.70
12/01/18	11:44:38 AM	0.08	0.55	0.05	94.10	101.90	91.60
16/01/18	11:20:52 AM	0.07	0.20	0.04	107.90	112.10	107.70
16/01/18	11:21:24 AM	0.27	3.28	0.14	107.70	107.50	98.10
18/01/18	11:35:28 AM	0.13	0.11	0.01	93.30	96.50	87.70
18/01/18	11:36:37 AM	0.07	0.51	0.03	92.90	97.10	83.60
20/01/18	3:35:52 PM	0.11	1.13	0.03	104.70	104.20	106.10
24/01/18	10:55:54 AM	0.74	1.86	0.15	93.20	99.80	89.30
25/01/18	3:23:49 PM	0.18	0.53	0.13	91.90	99.80	86.70
29/01/18	11:12:48 AM	0.76	2.55	0.17	106.60	104.70	98.70
29/01/18	11:13:36 AM	0.16	1.31	0.05	107.50	101.50	94.20

For the Reporting Period, overpressure and ground vibration data were below the maximum criteria and within the 5% allowance limit.

Appendix A

PM10 Monitoring Locations



MUSWELLBROOK

PM4

Wybong Road

PM1

PM2

Bengalla Link Road

PM3



BENGALLA MINE

PM10 Monitoring Locations

PRJ31060_BengallaMineNSW_50cm_19102017_gda94mga56_ortho_full-area

Appendix B

TSP Monitoring Locations



PRJ31060_BengallaMineNSW_50cm_19102017_gda94mga56_ortho_full-area




BENGALLA MINE
TSP Monitoring Locations

Appendix C

Depositional Dust Monitoring Locations

PRJ31060_BengallaMineNSW_50cm_19102017_gda94mga56_ortho_full-area

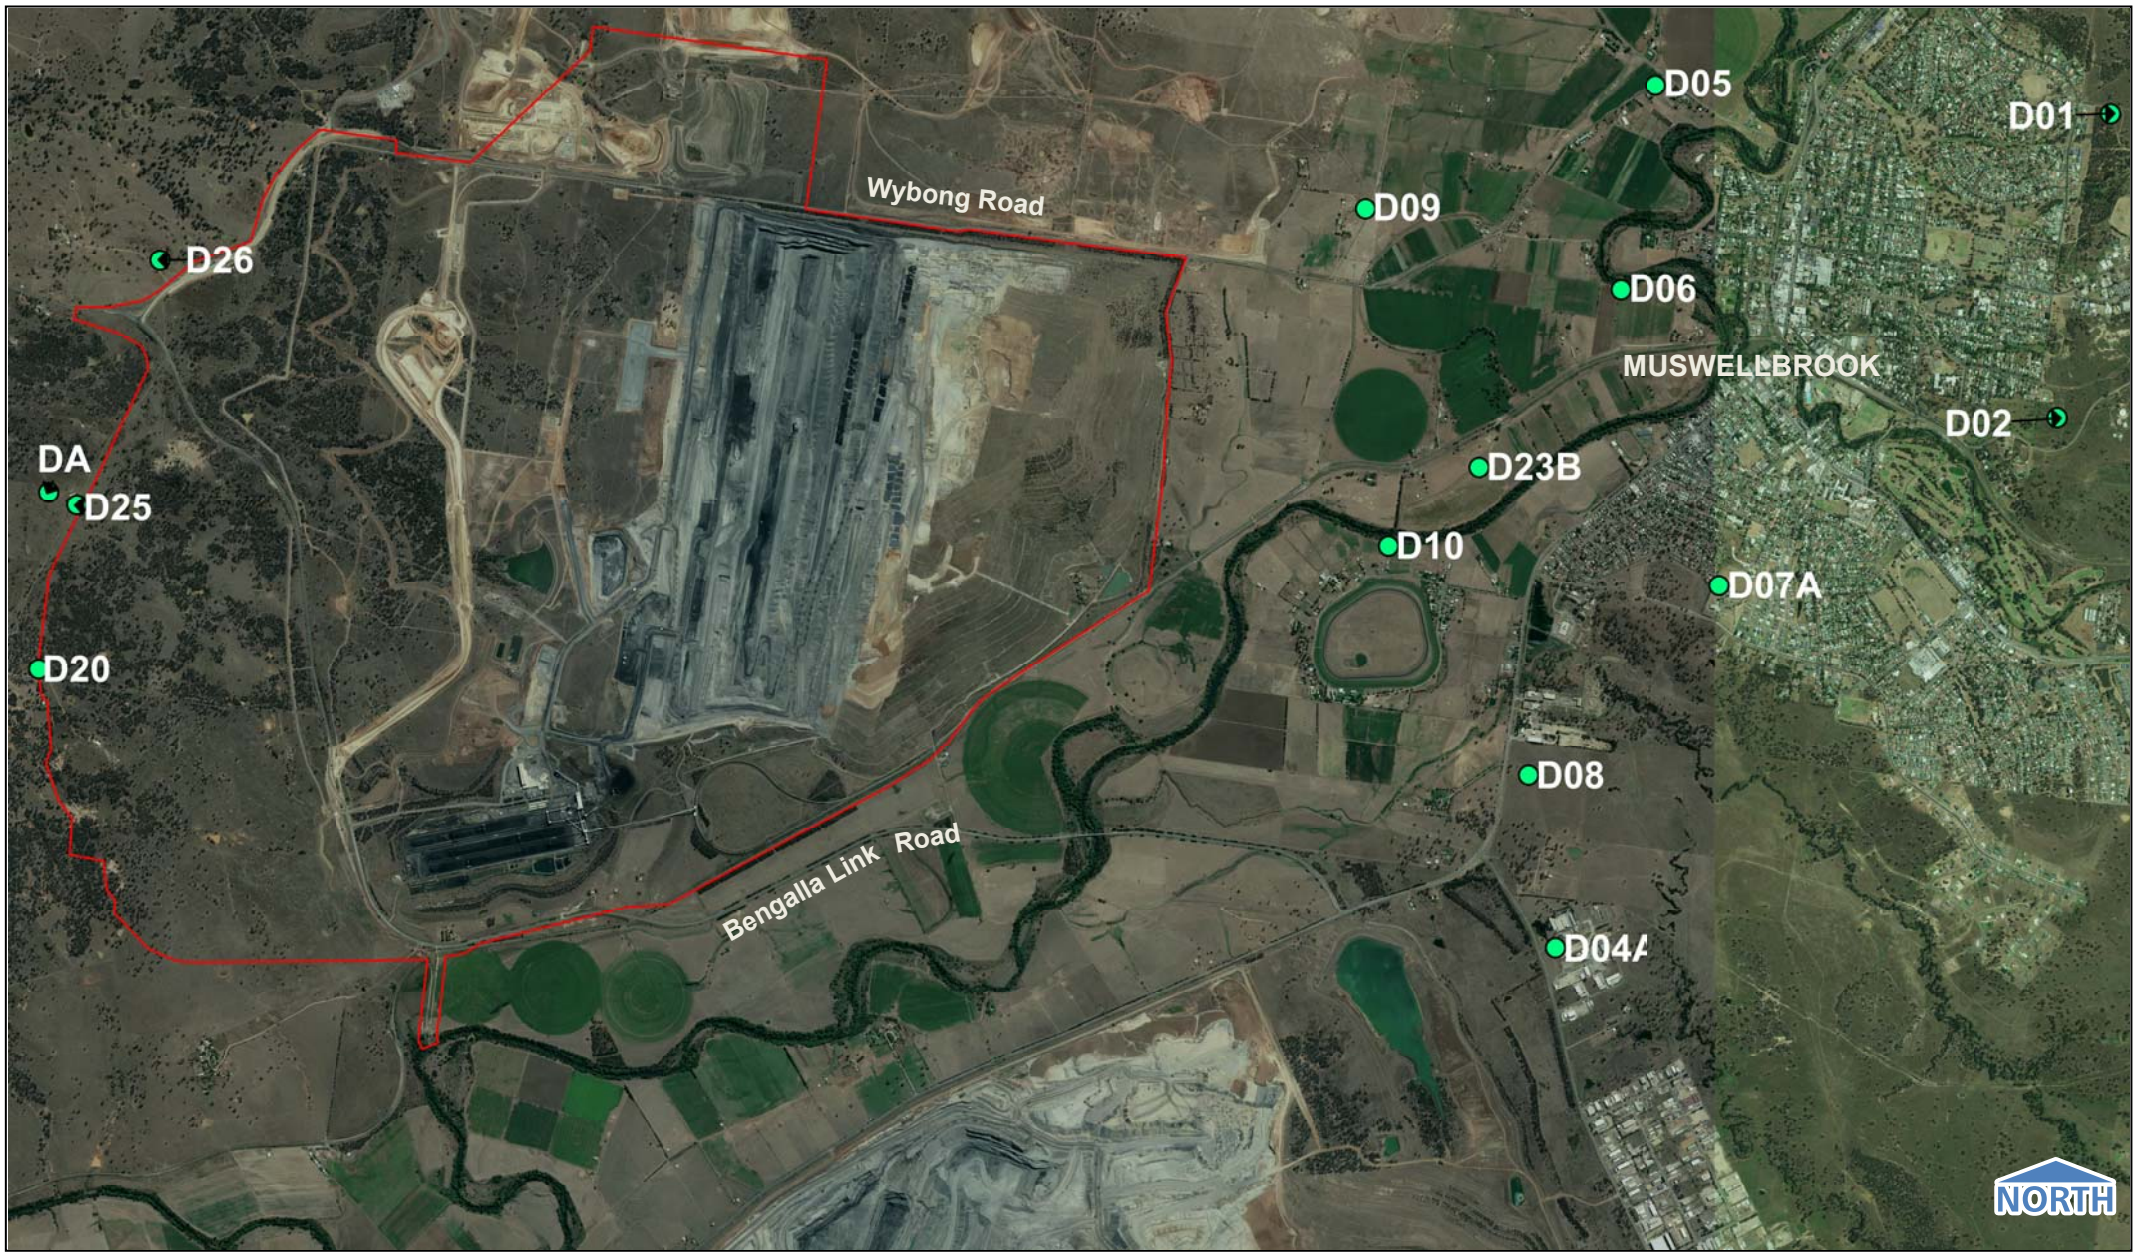


BENGALLA MINE
Depositional Dust Monitoring Locations

Appendix D

Noise and Blast Monitoring Locations

Location	Easting	Northing
BLK (EPA20)	300098	6429731
MRE (EPA12)	292469	6428948
SCH (EPA19)	300730	6426731
AN01 (EPA07)	289836	6428049
AN03 (EPA08)	290861	6421509
AN04 (EPA09)	298808	6426782

HB BENGALLA EPL 1428 F1 Bengalla Compliance Acoustic Monitoring Network - Aerial Version 09 09 2016

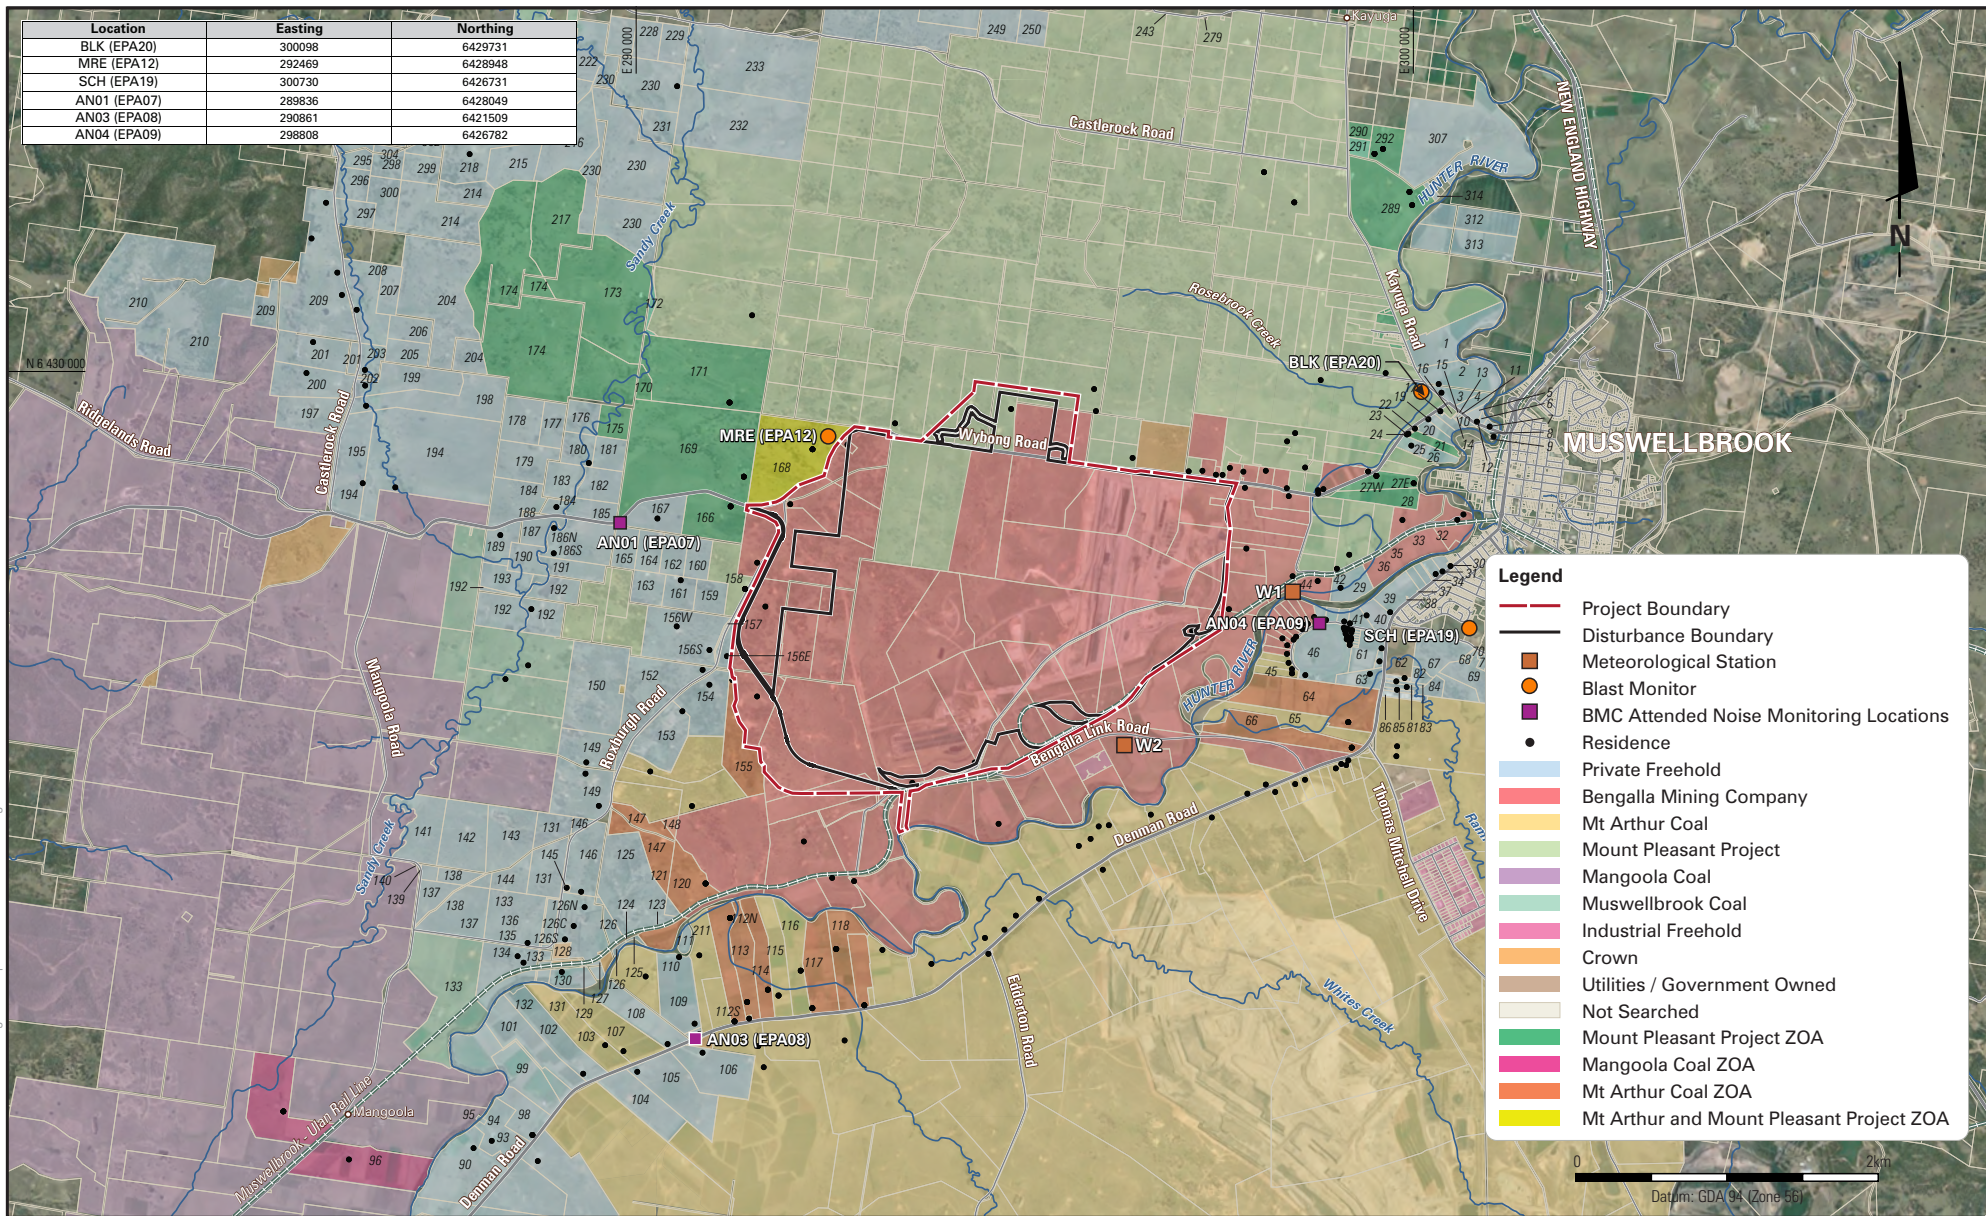

BENGALLA MINE



Bengalla Compliance Acoustic Monitoring Network

FIGURE 1