



**NEW HOPE**  
**GROUP**

**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

T: +61 2 6542 9500  
F: +61 2 6542 9599

ABN 32 053 909 470

[bengalla.com.au](http://bengalla.com.au)

## **Bengalla Mine**

# **State Significant Development 5170 Monthly Monitoring Data Summary**

**May 2021**



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

T: +61 2 6542 9500  
F: +61 2 6542 9599

ABN 32 053 909 470

[bengalla.com.au](http://bengalla.com.au)

## CONTENTS

1. INTRODUCTION .....	3
2. AIR QUALITY .....	4
3. NOISE .....	8
4. BLASTING .....	9

## TABLES

Table 1. PM <sub>10</sub> Monitoring Summary .....	4
Table 2. TSP Monitoring Summary .....	5
Table 3. Depositional Dust Monitoring Summary .....	7
Table 4. Noise – Bengalla Only <sup>1</sup> LAeq (15 minute) Monitoring Summary .....	8
Table 5. Blast Overpressure Monitoring Summary .....	10



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

T: +61 2 6542 9500  
F: +61 2 6542 9599

ABN 32 053 909 470

[bengalla.com.au](http://bengalla.com.au)

## 1. INTRODUCTION

State Significant Development (SSD) 5170 (as modified) requires the Bengalla Mining Company Pty Ltd (BMC) to make a comprehensive summary of the Bengalla Mine (Bengalla) monitoring results, reported in accordance with the specifications in any conditions of SSD-5170 (as modified), or any approved plans and programs, publicly available on its website. This document has been prepared in accordance with the Department of Planning and Environment (DPE) *Web-Based Reporting Guideline* (October 2015) to satisfy the above requirement.

This document provides a summary of environmental monitoring data sampled as prescribed by SSD-5170 (as modified) for May 2021 (Reporting Period). Monitoring data provided is as follows:

- Air quality, particulate matter less than 10 microns (PM<sub>10</sub>), total suspended particulate (TSP) matter and depositional dust;
- Noise; and
- Blast overpressure and ground vibration.

## 2. AIR QUALITY

The air quality monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Air Quality Management Plan (AQMP). Air quality monitoring results relevant to SSD-5170 are summarised in the following sections.

### 2.1 Particulate Matter less than 10 Microns

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains four High Volume Air Samplers (HVAS) measuring PM<sub>10</sub>. The HVAS are run for 24 hours every six days.

PM<sub>10</sub> data for the Reporting Period is provided in **Table 1**.

<b>Pollutant:</b>	PM <sub>10</sub>
<b>Unit of measure:</b>	Micrograms per cubic metre (µg/m <sup>3</sup> )
<b>Monitoring location:</b>	See <b>Table 1</b> and <b>Appendix A</b> .
<b>Monitoring frequency:</b>	24 hours every 6 days
<b>24 Hour Average Criteria:</b>	50 µg/m <sup>3</sup>
<b>Annual Average Criteria:</b>	25 µg/m <sup>3</sup>
<b>Sampled:</b>	01/05/2021 – 31/05/2021

**Table 1. PM<sub>10</sub> Monitoring Summary**

Run Date	Run Date Reading (µg/m <sup>3</sup> )			
	PM10-1 Racecourse Road	PM10-2 St James School	PM10-3 Roxburgh Road	PM10-4 Wybong Road
03/05/2021	15.9	16.8	11.5	23.3
09/05/2021	13.1	13.8	9.7	28.8
15/05/2021	28.0	15.9	8.5	8.4
21/05/2021	13.3	21.5	22.5	13.7
27/05/2021	20.3	16.9	5.2	4.1

(Table 1 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))

## 2.2 Total Suspended Particle Matter

To evaluate the performance of Bengalla against the SSD-5170 criterion for particulate matter, BMC operates and maintains five HVAS measuring TSP. The HVAS are run for 24 hours every six days.

TSP data for the Reporting Period is provided in **Table 2**.

<b>Pollutant:</b>	TSP
<b>Unit of measure:</b>	µg/m <sup>3</sup>
<b>Monitoring location:</b>	See <b>Table 2</b> and <b>Appendix B</b> .
<b>Monitoring frequency:</b>	24 hours every 6 days
<b>Annual Average Criteria:</b>	90 µg/m <sup>3</sup>
<b>Sampled:</b>	01/05/2021 – 31/05/2021

**Table 2. TSP Monitoring Summary**

Run Date	Run Date Reading (µg/m <sup>3</sup> )				
	HV01 Wybong Road (East)	HV02 Racecourse Road	HV03 Logues Lane	HV04 St James School	HV06 Wybong Road (West)
03/05/2021	99.9	56.4	39.9	49.4	77.4
09/05/2021	69.0	44.2	33.8	35.4	63.2
15/05/2021	39.3 <sup>#1</sup>	94.6	63.9	76.9	23.9
21/05/2021	46.0	38.9	32.9	41.1	59.6 <sup>#2</sup>
27/05/2021	88.7	70.9	46.7	66.7	16.8

(Table 2 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))

#1 - Run date 17 May 2021

#2 – Run date 25 May 2021



**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## 2.3 Depositional Dust

To evaluate the performance of Bengalla against the SSD-5170 criterion for depositional dust, BMC operates and maintains 14 depositional dust gauges surrounding the Bengalla operations.

Depositional dust data for the Reporting Period is provided in **Table 3**.

<b>Pollutant:</b>	Depositional Dust
<b>Unit of measure:</b>	Grams per metre squared per month (g/m <sup>2</sup> /month)
<b>Monitoring location:</b>	See <b>Table 3</b> and <b>Appendix C</b> .
<b>Monitoring frequency:</b>	Monthly
<b>Maximum depositional dust increase criteria:</b>	2 g/m <sup>2</sup> /month <sup>(b)</sup>
<b>Maximum total depositional dust criteria:</b>	4 g/m <sup>2</sup> /month <sup>(a)</sup>
<b>Sampled:</b>	16/4/2021 – 17/5/2021

(a) *Total impact (ie incremental increase in concentrations due to the development plus background concentrations due to other sources);*

(b) *Incremental impact (ie incremental increase in concentration due to the development on its own)*

**Table 3. Depositional Dust Monitoring Summary**

Sampling point		Measured Value (April 2021) g/m <sup>2</sup> /month	Sampling Comments
D01	Queen Street, Muswellbrook	0.9	Insects
D02	King Street, Muswellbrook	1.2	Insects
D04A	Industrial Estate, Muswellbrook	2.0	Insects
D05	Intersection Kayuga and Wybong Road, Muswellbrook	2.2	Insects
D06	Logues Lane, Muswellbrook	2.1	Insects
D07A	St James School, Muswellbrook	1.5	Insects, spider
D08	Denman Road, Muswellbrook	1.4	Insects
D09	Wybong Road, Muswellbrook	3.3	Insects
D10	Racecourse Road, Muswellbrook	4.2	Insects
D20	Wyndams Arms R.O.W., Muswellbrook	3.7	Insects
D23B	Logues Lane, Muswellbrook	2.4	Insects
D25	Roxburgh Road, Muswellbrook	3.0	Insects
D26	Wybong Road, Muswellbrook	2.6	Insects
DA	Roxburgh Road, Muswellbrook	4.0	Insects, bird droppings (deemed contaminated by laboratory)

(Table 3 represents total impact (ie incremental increase in concentration due to the development plus background concentrations due to other sources))

### 3. NOISE

The noise monitoring program at Bengalla is undertaken in accordance with the requirements of SSD-5170 (as modified), EPL 6538 and the Bengalla Noise Management Plan (NMP).

Compliance attended noise monitoring is undertaken for 15 minutes once per calendar month during the night period (10 pm to 7 am) at three locations representative of the nearest private receivers.

Noise monitoring data for the Reporting Period is provided in **Table 4**.

<b>Pollutant:</b>	Noise – Bengalla Only
<b>Unit of measure:</b>	L <sub>Aeq</sub> (15 minute)
<b>Monitoring location:</b>	See <b>Table 4</b> and <b>Appendix D</b> .
<b>Monitoring frequency:</b>	Monthly
<b>AN01 criteria:</b>	35 dB(A)
<b>AN04 criteria:</b>	35 dB(A)
<b>AN03 criteria:</b>	40 dB(A)
<b>Sampled:</b>	28 May and 29 May 2021

**Table 4. Noise – Bengalla Only<sup>1</sup> LAeq (15 minute) Monitoring Summary**

	Sampling point	Sample Date	Sample Time	Measured value
AN01	1431 Wybong Road	28/5/2021	23:21 – 23:36	30
AN03	1312 Denman Road	29/5/2021	00:03 – 00:18	IA
AN04	Opposite 9 Racecourse Road	29/5/2021	00:52 – 01:07	34

IA - Inaudible. When there was no noise from the source of interest (Bengalla Mine) audible at the monitoring location.

1. LAeq,15minute operational noise levels for Bengalla in the absence of all other noise sources.





**Bengalla Mining Company Pty Limited**

Bengalla Road (Locked Mailbag 5)  
Muswellbrook NSW 2333 Australia

ABN 32 053 909 470

T: +61 2 6542 9500

F: +61 2 6542 9599

[bengalla.com.au](http://bengalla.com.au)

## 4. BLASTING

BMC maintains three blast monitors to measure blast overpressure and ground vibration against the SSD-5170 criteria.

The blast overpressure and ground vibration data for the Reporting Period is provided in **Table 5**.

<b>Pollutant:</b>	Air blast overpressure & ground vibration peak particle velocity
<b>Unit of measure:</b>	dB (Lin Peak) and millimetres per second ( <b>mm/s</b> )
<b>Monitoring locations:</b>	See <b>Tables 5</b> and <b>Appendix D</b> .
<b>Monitoring frequency:</b>	All blasts
<b>Overpressure criteria:</b>	a) 115 linear decibels ( <b>dB(L)</b> ) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 120 dB(L) at any time.
<b>Ground vibration criteria:</b>	a) exceed 5 millimetres/second ( <b>mm/s</b> ) for more than 5% of the total number of blasts carried out on the premises within the 12 months annual reporting period; and b) 10mm/s at any time.
<b>Sampled:</b>	01/05/2021 – 31/05/2021

**Table 5. Blast Overpressure Monitoring Summary**

Date	Time	Ground Vibration (mm/s)			Overpressure (dBL)		
		BLK	MRE	SCH	BLK	MRE	SCH
01/05/21	2:57:34 PM	0.13	0.52	0.11	92.80	102.70	97.20
03/05/21	2:55:26 PM	0.09	1.11	0.04	93.60	97.60	93.30
06/05/21	11:09:12 AM	0.20	0.76	0.19	103.30	96.20	103.50
10/05/21	2:50:47 PM	0.13	1.13	0.08	91.10	105.00	99.50
10/05/21	2:51:43 PM	0.12	0.79	0.09	93.90	104.40	93.40
11/05/21	3:19:05 PM	0.12	0.87	0.06	93.00	91.70	92.60
13/05/21	3:02:40 PM	0.24	2.12	0.14	95.10	96.40	90.50
15/05/21	2:57:06 PM	0.15	0.79	0.04	99.80	109.90	103.30
17/05/21	12:10:10 PM	0.12	0.71	0.09	87.40	98.90	91.80
20/05/21	3:06:24 PM	0.14	0.73	0.10	92.90	99.00	98.10
22/05/21	11:30:31 AM	0.31	2.59	0.17	104.20	105.10	92.80
24/05/21	10:58:43 AM	0.13	0.90	0.03	98.10	107.60	85.00
24/05/21	10:58:57 AM	0.13	0.83	0.03	98.10	107.70	100.10
25/05/21	1:58:56 PM	0.08	0.96	0.03	94.70	102.20	92.80
26/05/21	2:54:36 PM	0.30	2.13	0.14	96.00	102.30	89.60
27/05/21	11:55:23 AM	0.55	2.66	0.15	83.60	93.60	91.50
29/05/21	11:32:21 AM	0.18	1.57	0.05	90.60	101.30	98.10
31/05/21	2:55:11 PM	0.31	2.24	0.10	92.90	105.20	89.10

# **Appendix A**

## **PM10 Monitoring Locations**



BENGALLA MINE  
 PM10 Monitoring Locations

# **Appendix B**

## **TSP Monitoring Locations**





PRJ31060\_BengallaMineNSW\_50cm\_19102017\_gda94imga56\_ortho\_full-area



**BENGALLA MINE**  
**TSP Monitoring Locations**

# **Appendix C**

## **Depositional Dust Monitoring Locations**





PRJ31060\_BengallaMineNSW\_50cm\_19102017\_gda94mgas6\_ortho\_full-area




BENGALLA MINE  
 Depositional Dust Monitoring Locations



# **Appendix D**

## **Noise and Blast Monitoring Locations**

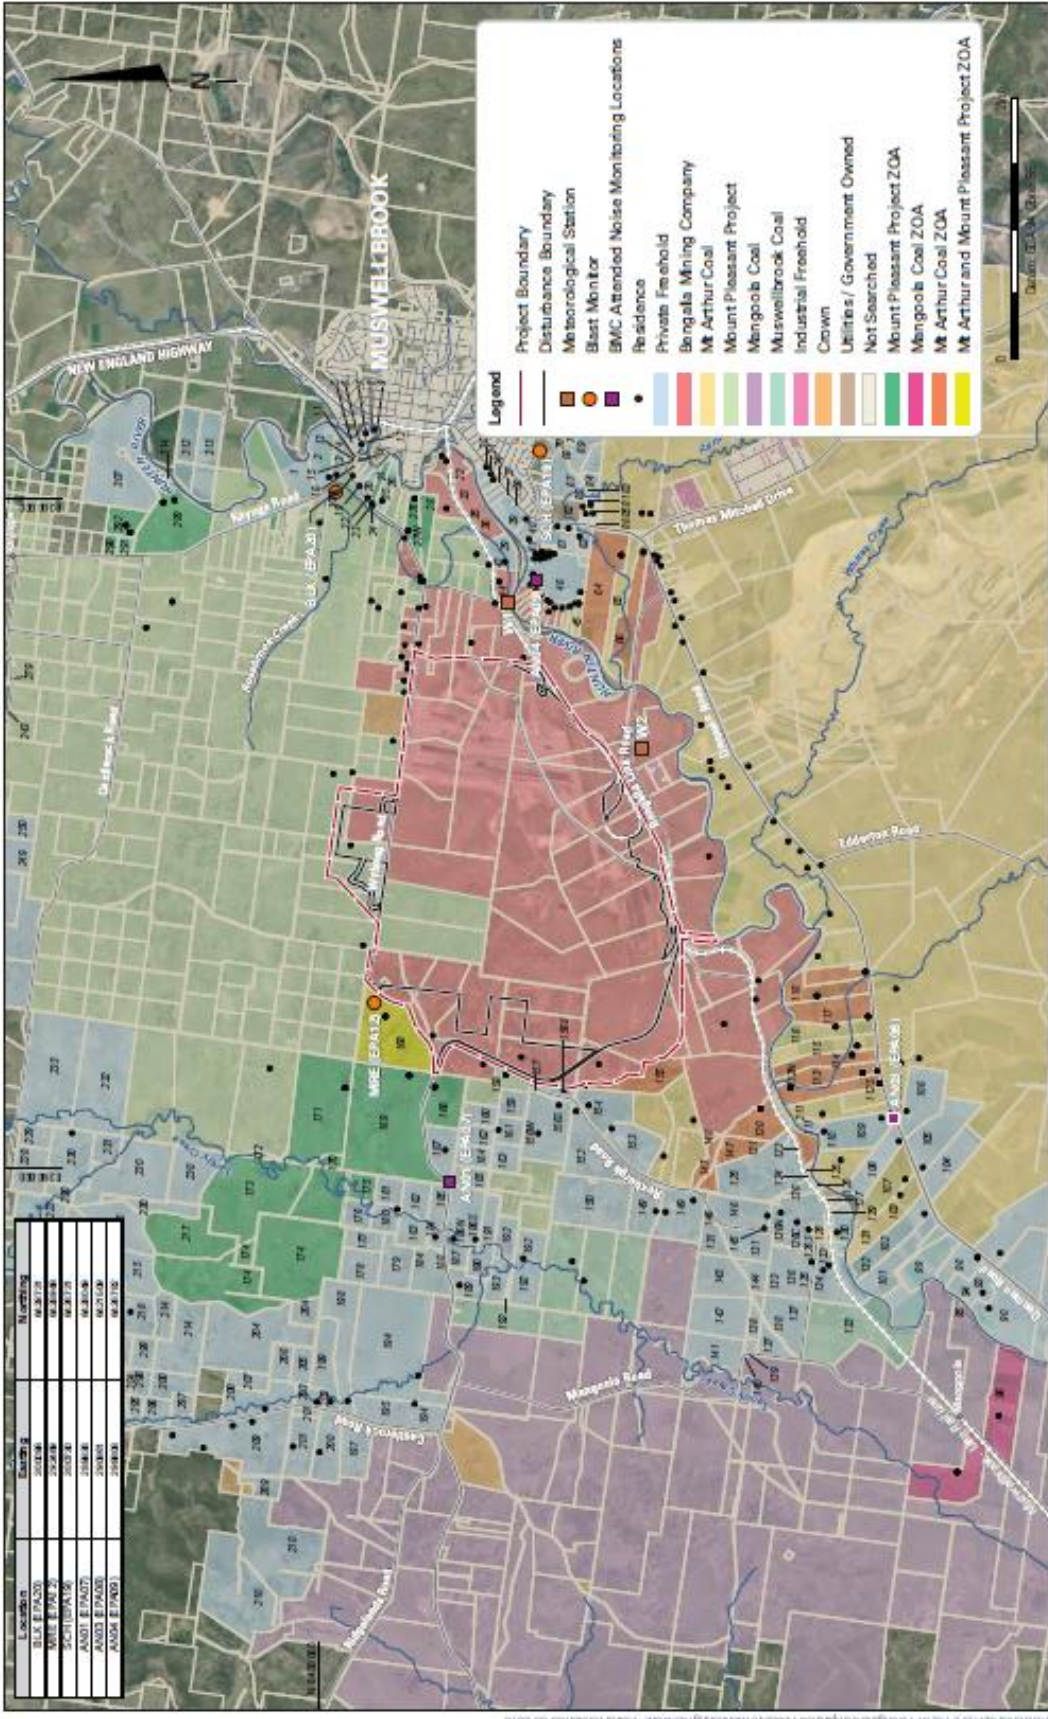

BENGALLA MINE

Bengalla Compliance Acoustic Monitoring Network

Hansen Bailey



FIGURE 1

BENGALLA BM 14287 Bengalla Compliance Acoustic Monitoring Network - Audit (version 03) 2019